

Motor protection relay, phase failure/single-phase sensitive. Three-pole (three-phase), manual or automatic resetting, 90...150A



Product designation			RF200
Product type designation			Motor protection relay
General characteristics			
Number of poles		Nr.	3
Overvoltage category			III
Pollution degree			3
Frontal IP degree			IP20
Type of release			Thermal
Protection fuse			
	gG (IEC)	Α	250
	aM (IEC)	Α	160
	K5 (UL)	Α	500
Phase failure detection			No
Decet made			Manual or
Reset mode			automatic
Power circuit characteristics			
Rated insulation voltage Ui IEC/EN		V	1000
Rated impulse withstand voltage Uimp		kV	6
Rated operational voltage		V	690
Operational frequency			
	min	Hz	50
	max	Hz	60
Operational current le			
	Operational current min	Α	90
	Operational current max	Α	150
Tripping class			10A
Test Button			Yes
Trip indicator			Yes
Terminals			
	type		screw and flat washer
	screw		M8
	width	mm	20
	tool		Bar 13mm
Tightening torque for terminals			
	min	Nm	18
	max	Nm	18
	min	Ibin	13.3
	max	Ibin	13.3
Auxiliary circuit characteristics			
Auxiliary contacts			
•	NO	Nr.	1
	NC	Nr.	1
Auxiliary Rated insulation voltage Ui IEC/EN		V	690
,			


ENERGY AND AUTOMATION

Motor protection relay, phase failure/single-phase sensitive. Three-pole (three-phase), manual or automatic resetting, 90...150A


Auxiliary Rated impulse withstand voltage Uimp		kV	6
Auxiliary Rated operational voltage		V	690
Operating current AC15			
	24V	Α	3
	120V	Α	3
	240V	Α	1.5
	380V	Α	0.95
	480V	Α	0.75
	500V	Α	0.72
	600V	Α	0.6
Operating current DC13			
	125V	Α	0.11
	600V	Α	0.22
EC Conventional free air thermal current Ith		A	10
reminals			
			Screw and
	Auxiliary circuit type		washer
	Auxiliary circuit screw		M3,5
	Auxiliary circuit width	mm	8
	Auxiliary circuit tool		Phillips 2
Conductor section	Adamary or our tool		1 milpo 2
onductor section	Auxiliary circuit Flexible w/o lug max	mm²	2.5
	Auxiliary circuit Flexible c/w lug max	mm²	2.5
ightening torque for terminals	Addition of the control of the contr	111111	2.5
ignitering torque for terminals	Auvilian cairouit min	Nim	0.0
	Auxiliary circuit min	Nm Nas	0.8
	Auxiliary circuit max	Nm	1
	Auxiliary circuit min	Ibin	0.59
II /CCA and IEC/EN COOAZ E 4 designation	Auxiliary circuit max	Ibin	0.74
JL/CSA and IEC/EN 60947-5-1 designation			B600-R300
mbient conditions			
Operating temperature		0.0	0.5
	min	°C	-25
	max	°C	60
Storage temperature			
	min	°C	-50
	max	°C	70
Compensation temperature			
	min	°C	-20
	max	°C	60
flax altitude		m	3000
lechanical features			
perating position			
	normal		Vertical plan
	allowable		±30°
ixing			Screw
Veight		g	2150
JL technical data			
Full-load current (FLA) for three-phase AC motor			
, , ,	at 480V	Α	150
	at 600V	Α	150
Dimensions		-	

ENERGY AND AUTOMATION

Motor protection relay, phase failure/single-phase sensitive. Three-pole (three-phase), manual or automatic resetting, 90...150A

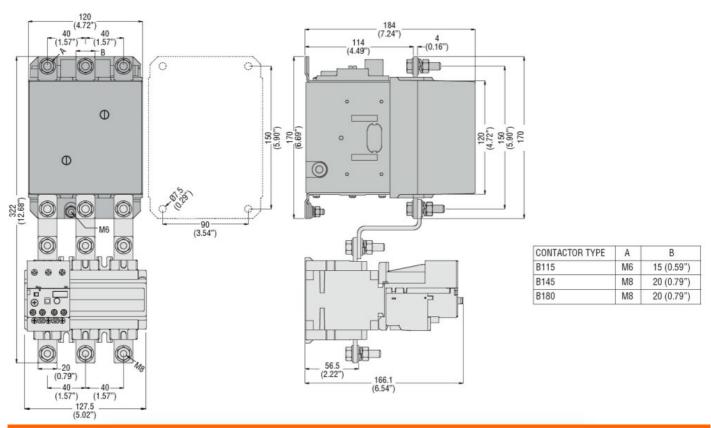

Wiring diagrams

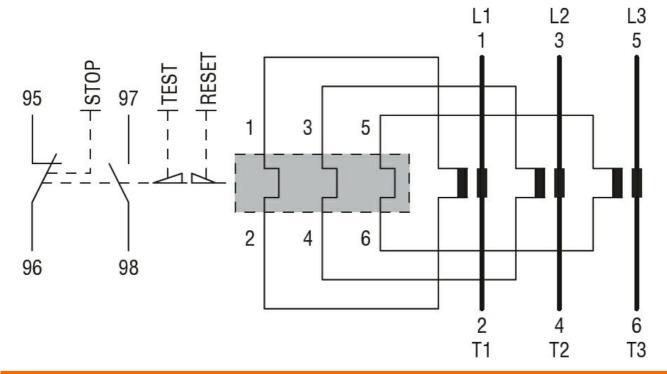

Certifications and compliance

Compliance

CSA C22.2 n° 14

IEC/EN 60947-1

IEC/EN 60947-4-1

UL508

Certifications



RF200150

Motor protection relay, phase failure/single-phase sensitive. Three-pole (three-phase), manual or automatic resetting, 90...150A

cULus
EAC

ETIM classification

ETIM 8.0

EC000106 -Thermal overload relay